



December 06, 2014

STMicroelectronics
629 Lorong 4/6 - TOA PAYOH
Singapore 319521
Republic Of Singapore
Attention: Mr. CS Ler

Dear Sir,

This serves to certify that I, the undersigned, have completed an audit on Sapphire EWTCE007 S/N. 70176 in STM Toa Payoh on December 5th, 2014.

The System Audit has qualified the system on the following parameters.

1. System hardware configuration available:
 - a) 1x Sapphire Standard test system configured for 415VAC incoming running on Windows XP and XTOS 4.1P03
 - b) 20x pcs D4064
 - c) 4x pcs 6ADPS
 - d) 1 pc THIF
 - e) 1 pc GPVI
2. Full Calibrations and Diagnostics had passed including NIST utilizing DMM S/N. 2823A13055 with due date on 30th Oct 2015.
3. The following defectives were noted :
 - a) Slot 35 D4064 Instrument (S/N. 96152147-0610076R) fails path and deskew calibrations
 - b) Slot 28 D4064 Instrument (S/N. 96152147-0549012R) fails NIST calibrations.
 - c) Minor dents and scratches are visible on skins as a result of utilization.
4. There is no QBIX instrument installed in this system.
5. There is no noticeable HFE system leaks observed.
6. System photos are included in the next section.

Mr. Phillip Ling
Snr. Systems Engineer
Global Customer Team
Xcerra Corporation


LTX-Credence Singapore Pte Ltd
(Incorporated in the Republic of Singapore With Limited Liability)
6 SERANGOON NORTH AVENUE 5 #03-06
Singapore 554910
Tel: 6408 8408 Fax: 6720-9040

Xcerra Corporation

825 University Avenue | Norwood, MA 02062-2643 | T: 781-461-1000 | www.Xcerra.com



System Photographs

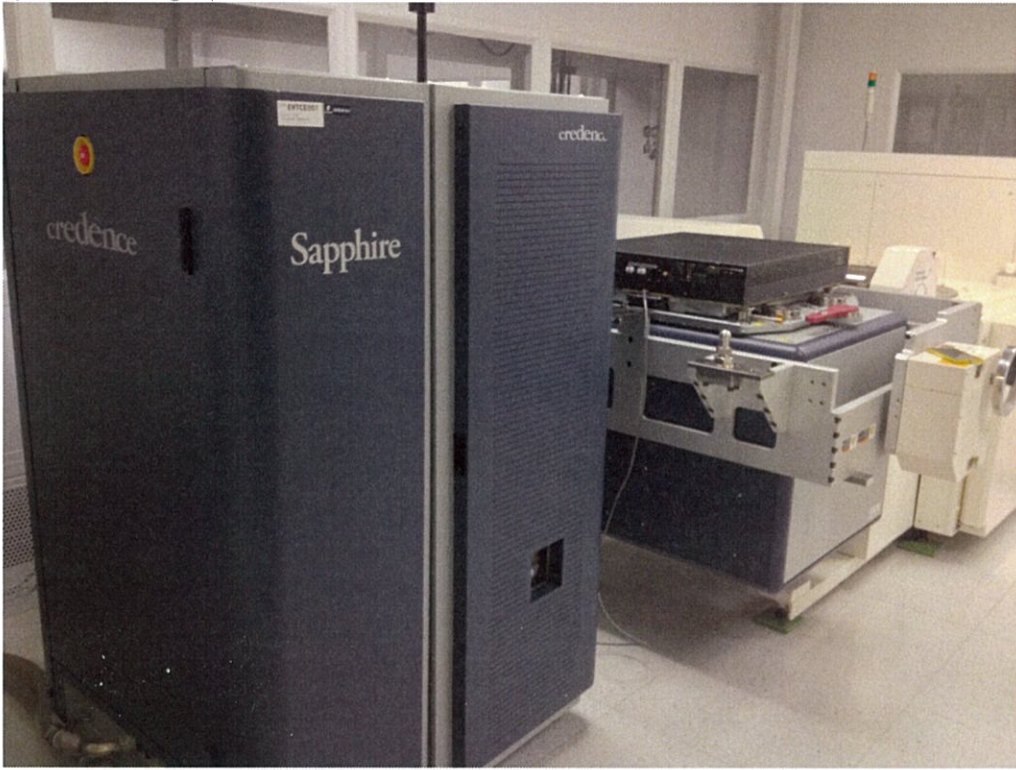

Xcerra Corporation

825 University Avenue | Norwood, MA 02062-2643 | T: 781-461-1000 | www.Xcerra.com





Additional Photographs In Thumbnails



Xcerra Corporation

825 University Avenue | Norwood, MA 02062-2643 | T: 781-461-1000 | www.Xcerra.com

